

## TECHNICAL INFORMATION

DATE OF ISSUE: May. 25, 2026

ISSUE NO.: CSPD-2026-081

### BPC131WD- BPC131PW- OCCASIONAL ERROR IN HTTPS COMMUNICATION VIA PROXY

HTTPS communication via a proxy may result in errors with the firmware version listed below.

\*As of now, there have been no reports from the market regarding this matter.

The special ROM addressing this issue has been released. Please install the special ROM on an individual basis when the trouble is reported.

#### [Applicable models/Firmware version]

Applicable models		Firmware version
Maia MFP	BP-C131WD	CCE-3451: 0400E200_25121100 CCE-3525: 0402E200_26042700
Maia Printer	BP-C131PW	CCE-3451: 0400E200_25121100 CCE-3525: 0402E200_26042700

#### [Symptom]

When HTTPS communication for the following functions is routed through a proxy, some proxy servers may flag it as an error.

- FSS
- Enhanced FSS
- SMTP OAuth authentication

#### [Cause]

When introducing OSA-LE, a merge from the CR series was performed to enable IPv6 for HTTP communication. However, the "Host header" for HTTP was not included when connecting to the proxy server via HTTPS due to a merge mistake.

#### [Firmware modification]

- MaiaMFP\_0402E2a0\_26052000
- MaiaPrinter\_0402Y2a0\_26052000
- Helios\_0402C2a0\_26052000

\*We are working towards official firmware support with a target release date of July 2026 (RC).